Model	QQ 7110	Trouble Category	Electrical
Road Mileage	8,000 KM		

Possible Trouble(s):

The right front door glass DOWN automatically.

Trouble Analysis:

The QQ glass UP/DOWN signal is an earthing signal, and easily subject to be interfered after the water intake. In addition, the fault also represents as: after the vehicle is locked using its remote controller, the glass doesn¡t UP or UP and then DOWN. The reason to result this symptom is the glass switch UP/DOWN signal failure, water intake, cable wear broken and earthing, and other failures (the red circuits are easily subject to the problem, and the blue circuits are the glass UP/DOWN switches).

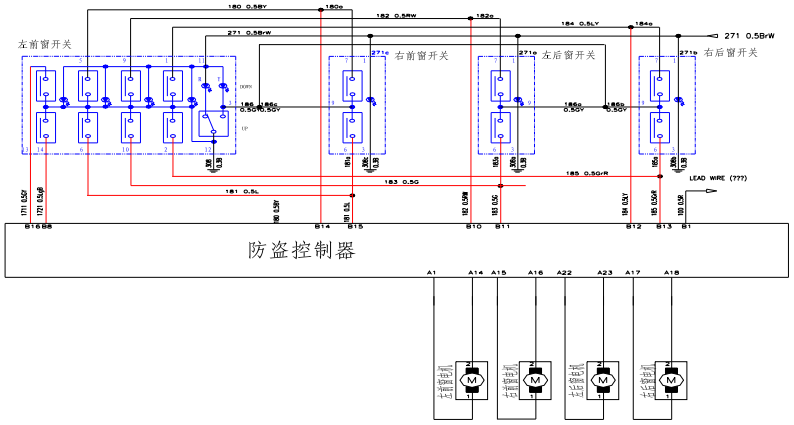

Troubleshooting:

According to the owner¡s feedback, we know that the problem occurs after the vehicle is rinsed. Later, carefully check the four door switch signals, and then find that there are some water traces in the right front door switches. After these switches are dried, the trouble is removed.

Final Measure(s):

The water enters into the right front door switches, and the trouble is removed after these switches are dried.